3357752

REVIEWED FOR APPLICABLE TAXES
APPROVED FOR RECORDING
LEWIS COUNTY TREASURER
BY _____ DATE 8/4/11

REVIEWED FOR COMPLIANCE
WITH RECORDING ENGINEERING
LEWIS COUNTY
BY _____ DATE 8-4-11

3357752 B: 28 P: 31 SUR
08/04/2011 11:48:32 AM Total Pages: 1 Fees: 126.00
Gary E. Zandell, Lewis County Auditor, Chehalis, Washington

Portions of the NE 1/4, NW 1/4 and SW 1/4 of Section 29, Township 13 North, Range 3 West, W.M. in Lewis County, Washington.

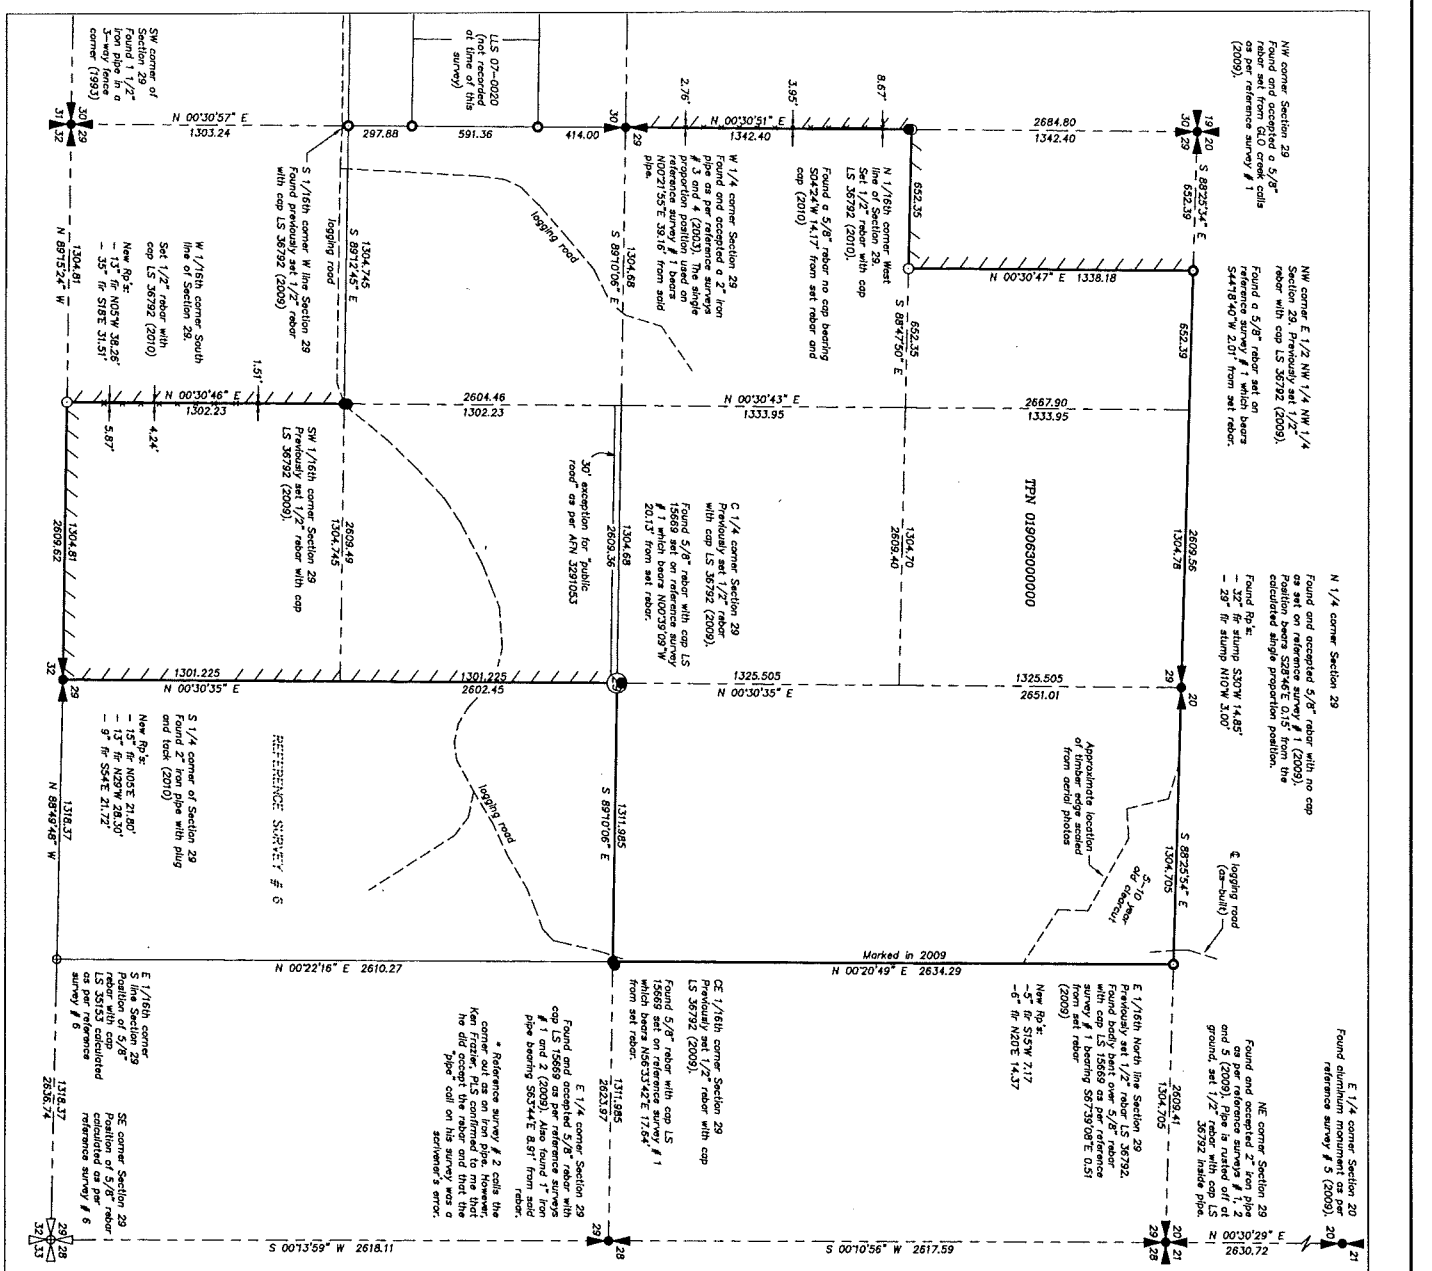
NW corner Section 29
Found and accepted a 5/8" rebar set from G.L.O. creek calls as per reference survey # 1 (2009).
NW corner E 1/2 NW 1/4 NW 1/4 Section 29. Previously set 1/2" rebar with cap LS 36792 (2009).
Found a 5/8" rebar set on reference survey # 1 which bears S44°18'40"W 2.01' from set rebar.
E 1/4 corner Section 20
Found aluminum monument as per reference survey # 6 (2009).
N 1/4 corner Section 29
Found and accepted 5/8" rebar with no cap as per reference survey # 1 (2009). Position is calculated by single proportion position.
Found Rp's:
- 32" fir stump S30°W 14.85'
- 29" fir stump N10°W 3.00'
NE corner Section 29
Found and accepted 2" iron pipe as per reference surveys # 1, 2 and 5 (2009). Pipe is rusted off at ground, set 1/2" rebar with cap LS 36792 inside pipe.
SW corner of Section 29
Found 1 1/2" iron pipe in a 3-way fence corner (1993)
LLS 07-0020 (not recorded at time of this survey)
W 1/4 corner Section 29
Found and accepted a 2" iron pipe as per reference surveys # 3 and 4 (2010). Line shigle proportion position from reference survey # 1 bears N00°21'55"E 39.16' from said pipe.
Found a 5/8" rebar no cap bearing S04°24'W 14.17' from set rebar and cap (2010)
N 1/16th corner West line of Section 29. Set 1/2" rebar with cap LS 36792 (2010).
W 1/16th corner South line of Section 29. Set 1/2" rebar with cap LS 36792 (2010)
New Rp's:
- 13" fir N05°W 38.26'
- 35" fir S18°E 31.51'
S 1/16th corner W line Section 29 Found previously set 1/2" rebar with cap LS 36792 (2009)
SW 1/16th corner Section 29 Previously set 1/2" rebar with cap LS 36792 (2009).
C 1/4 corner Section 29 Previously set 1/2" rebar with cap LS 36792 (2009).
Found 5/8" rebar with cap LS 15669 set on reference survey # 1 which bears N00°39'09"W 20.13' from set rebar.
30' exception for "public road" as per AFN 3291053
TPN 019063000000
Approximate location of timber edge scaled from aerial photos
5-10 acre clearcut
℄ logging road (as-built)
logging road
E 1/16th North line Section 29 Previously set 1/2" rebar LS 36792. Found bady bent over 5/8" rebar with cap LS 15669 as per reference survey # 1 bearing S67°39'08"E 0.51' from said rebar (2009)
New Rp's:
-5" fir S15°W 7.17'
-6" fir N20°E 14.37'
CE 1/16th corner Section 29 Previously set 1/2" rebar with cap LS 36792 (2009).
Found 5/8" rebar with cap LS 15669 set on reference survey # 1 which bears N36°33'42"E 17.64' from set rebar.
E 1/4 corner Section 29 Found and accepted 5/8" rebar with cap LS 15669 (2009) as per reference survey # 1 and 2. (2009). Position from said pipe bearing S83°44'E 8.91' from said rebar.
* Reference survey # 2 calls the corner out as on from pipe. However, the PLS on from pipe. However, he did accept the rebar and that the "pipe" call on his survey was a scrivener's error.
E 1/16th corner S line Section 29 Position of 5/8" rebar with cap LS 35153 calculated as per reference survey # 6
S 1/4 corner of Section 29 Found 2" iron pipe with plug and tack (2010)
New Rp's:
- 15" fir N05°E 21.80'
- 13" fir N29°W 28.30'
- 9" fir S54°E 21.72'
SE corner Section 29 Position of 5/8" rebar with cap LS 35153 calculated as per reference survey # 6
REFERENCE SURVEY # 6
N 00°30'57" E 1303.24
297.88
591.36
414.00
N 00°30'51" E 1342.40
2684.80 1342.40
S 88°25'34" E 652.39
652.35
N 00°30'47" E 1338.18
S 88°47'50" E 652.35
N 00°30'46" E 1302.23
2604.46 1302.23
N 00°30'43" E 1333.95
2667.90 1333.95
N 89°15'24" W 1304.81
1304.745
S 89°12'45" E
S 89°10'06" E 1304.68
1304.70 2609.40
2609.56 1304.78
2609.49 1304.745
2609.36
1304.68
2609.62 1304.81
1301.225 2602.45
N 00°30'35" E
1325.505 N 00°30'35" E
1325.505 2651.01
2609.41 1304.705
S 88°25'34" E 1304.705
S 89°10'06" E 1311.985
1311.985 2623.97
N 00°22'16" E 2610.27
Marked in 2009 N 00°20'49" E 2634.29
N 89°49'48" W 1318.37
1318.37 2638.74
S 00°13'59" W 2618.11
S 00°10'56" W 2617.59
N 00°30'29" E 2630.72
2609.41 1304.705
1304.81
1304.78
1304.705
1304.70
2609.40
1304.68
2609.36
1304.745
2609.49
1304.81
2609.62
1304.81
2609.56